

1300 781 363
admin@carinspecta.com.au



Carinspecta Pre-Purchase Platinum Inspection Report

2nd Feb, 2026 / [REDACTED] / CARINSPECTA_1077

Ref no#

CARINSPECTA_1077

Inspection date

2nd Feb, 2026

Inspection by



Service type

Platinum Inspection

Location

1/2 Rupert Court, Broadmeadows VIC, Australia

Buyer's name



Buyer's email



Buyer's contact



Seller's name



Seller's contact



THIS IS NOT A ROADWORTHY CHECK/REPORT

Cooling System

Radiator pressure test

Attention/Flagged

System pressure does not hold; further inspection required.



Photo 1

Vehicle Details

Car make	Mazda
Car model and badge	CX7
Registration no.	[REDACTED]
Expiry Date	[REDACTED]
State	Victoria
Compliance	2009
Colour	BLACK
Service Book	No
Odometer reading	152944



Photo 2

Engine number	[REDACTED]
VIN	[REDACTED]



Photo 3

Number of cylinders	4
No. of doors	5
Transmission type	Automatic
Engine type	Internal Combustion Engines

Engine

Head gasket (visual inspection)

Unhealthy Condition

Engine misfire & vibration

Not Applicable

Intake manifold

General Wear & Tear

Engine oil leak

Major Leak



Photo 4

Engine mounts

General Wear & Tear



Photo 5

Turbo charger

Minor Leak

Oil cap deposit and oil condition

General Wear & Tear



Photo 6

Cold / hot engine runs and engine performance

Bad Condition

Notes

Radiator is split and coolant has leaked. Due to coolant loss and overheating, a blown head gasket is highly likely. Head gasket condition will be confirmed after radiator replacement and further testing. Engine oil leaks observed from multiple areas; further inspection required to identify exact sources.

Electrical & AC System

12V battery test, battery terminals and bracket

Bad Condition



Photo 7

Alternator operation

Good Condition

A/C condenser, compressor & lines

Good Condition

Drive belt or tensioner

General Wear & Tear



Photo 8

Starter motor

Good Condition

Relay & fuse box

General Wear & Tear

ECU Scan

Not Applicable



Photo 9

Notes

Battery test failed

Cooling System

Radiator pressure test

Attention/Flagged

System pressure does not hold; further inspection required.



Photo 10

Radiator, Radiator fan and Hoses

Major Leak



Photo 11

Coolant condition

Major Leak

Heater hoses & heater core

General Wear & Tear

Drive belt or tensioner

General Wear & Tear



Photo 12

Notes

Radiator is severely leaking; unable to perform further testing until replacement.

Power/Electric Steering

Steering rack

Good Condition

Steering rack ball joints

General Wear & Tear

Tie rod ends

General Wear & Tear

Power steering pump and hoses

Minor Leak

Power steering oil leaks and condition

Bad Condition

Electric power steering

Not Applicable

Steering knuckle

Not Applicable

Notes

Power steering pump leaking further inspection required

Fuel/LPG System

Fuel Filters

Not Applicable

Fuel Pump

Good Condition

Fuel Lines

General Wear & Tear

Fuel Injector

General Wear & Tear

Fuel Leakage

General Wear & Tear

Fuel Tank Inspection

General Wear & Tear



Photo 13

LPG Gas Converter

Not Applicable

LPG Gas Lines

Not Applicable

LPG Leakage

Not Applicable

Drive Line

Gearbox / transmission mounts

Average



Photo 14

Clutch & Clutch Pedal

Not Applicable

Driveshaft & boots condition

General Wear & Tear



Photo 15

Transfer case

Major Leak



Photo 16

Front differential

Not Applicable

Rear differential

Good Condition



Photo 17

Tail shaft centre bearing

General Wear & Tear

Notes

TRANSFER CASE MAJOR OIL LEAKED .GEAR SELECTOR PAINT REMOVED

Suspension System

Front control arm bushes

Damaged Area



Photo 18

Rear control arm bushes

Average



Photo 19

Front shock absorbers

Average



Photo 20

Rear shock absorbers

Medium

Sway bar links & torsion bar

Average



Photo 21

Ball joints

Average

Hub assembly / wheel bearings

Good Condition

Leaf springs

Not Applicable

Coil springs

General Wear & Tear

Differential bushes

General Wear & Tear

Struts

General Wear & Tear

Exhaust System

Exhaust smoke	Average
Exhaust manifold	General Wear & Tear
Mufflers and tail pipe	General Wear & Tear
Catalytic converter	General Wear & Tear
Exhaust leak	Not Applicable

Brakes System

Brake master cylinder

Good Condition

Front brake discs

Average

Rear brake discs

Low

Brake drums

Not Applicable

Brake calliper

General Wear & Tear

Brake cylinder

Not Applicable

Brake hoses

General Wear & Tear

ABS operation

Medium

Hybrid Vehicle (Platinum only)

Hybrid battery condition

Not Applicable

Hybrid Inverter

Not Applicable

Hybrid AC pump

Not Applicable

Hybrid water pump

Not Applicable

Hybrid inverter water pump

Not Applicable

Hybrid brake system

Not Applicable

Hybrid EV mode operation

Not Applicable

Hybrid PHV charger operation

Not Applicable

ABS operation

Not Applicable

Interior

Carpet condition / floor mats / dashboard

Average



Photo 22

Glove box / air vents

General Wear & Tear



Photo 23

Centre console / lids

Good Condition



Photo 24

Roof lining / Sunroof / Moonroof

Good Condition

Sun visors / interior lights / Rear view mirror

Other

LIGHTS GOOD ,REAR VIEW MIRROR BAD ,SUN VISOR GOOD



Photo 25

Comb switch / other switches

Good Condition

Power/manual windows operation

Good Condition

Front & rear wiper operation / Washers

General Wear & Tear

Fan speed control / air blower

General Wear & Tear

Heater operation

Other

BAD CONDITION DUE TO COOLANT LEAK

Air condition operation

General Wear & Tear

Head unit / CD Player / Radio / Navigation

Good Condition

Steering wheel grip / horn

Average

Park brake operation

Bad Condition

Seat belts

Other

NEED CLEANING



Photo 26

Front and rear seats (heater & operation) / seats condition

Average



Photo 27

Fuel gauges / temp gauges

Good Condition

Warning lights

Other

FUEL WARNING LIGHT IS ON



Photo 28

Exterior conditions images (extensive images for Platinum)

Bad Condition

Exterior

Windscreen, bonnet and bonnet struts

Damaged Area

Lights (Park / low & high beam / reverse / brake/ repeater / fog lenses / globes)

Good Condition



Photo 29

Side mirrors

Good Condition

Door lock and keys

Good Condition



Photo 30

Glass / trim / weather seals / rubber / mould strips

Average

Doors / Door seals

Average

Rear bumper / Boot & tailgate operation

Other

REAR BUMPER DAMAGNED AND TAIL GATE OPERATIONAL



Photo 31

Fuel lid

Good Condition

Spare wheel

Average

Tyres condition/ware

Medium



Photo 32

Tyre size

Not Applicable

Interior conditions images (extensive images for Platinum)

Average



Photo 33

Road Test Report (Driving vehicle)

Vehicle general drivability

Average

Speed limit when tested

60

Notes

Overall, the vehicle is in bad condition. Service history not available. Battery test failed and major oil leaks from various areas further inspection required. Health scan shows fault codes that need to be addressed and require further investigation.

Inspection Report Summary

Body/Exterior rating	Below Average
Interior rating	Average
Mechanical rating	Not Good
Overall vehicle rating	Not Good

Mechanic : [REDACTED]

Vehicle Condition Report

Condition Report

CONDITION LEGEND

- B Bent
- C Corrosion
- H Hole
- W Wave
- R Rust
- T Tear
- S Scratch or Crack

1. Small
2. Medium
3. Large

Example: D2 = Dent / Medium

Disclaimer:

THIS IS NOT A ROADWORTHY CHECK/REPORT

Please note that our inspection does not assess the alignment of vehicle parts or body panels, nor can it determine if any part is bent or deviates from its original shape. For concerns related to these issues, we recommend a consultation with a registered smash repairer. During our Comprehensive/Platinum Inspections, CarInspecta will identify significant damages and any evident previous accident repairs. However, due to the limitations imposed by inspecting vehicles in various on-site conditions, which may include poor lighting or vehicles being dirty, unwashed, or wet, minor defects such as small dents, scratches, or hail damage may not be recorded in our report. It remains the responsibility of the buyer to personally re-examine the vehicle prior to finalising the purchase.

Visit our website at www.carinspecta.com.au for more details.

Terms And Conditions

Effective Date: 01/01/2024

1. Introduction

These Terms and Conditions ("Terms") govern your use of the Car Inspecta website <https://carinspecta.com.au> and services provided by Car Inspecta. By accessing or using our website and services, you agree to comply with and be bound by these Terms.

2. Services Provided

Car Inspecta provides pre-purchase car inspection services. The inspection report is based on a visual assessment and does not involve dismantling parts of the vehicle.

3. Booking and Payment

- **Booking:** Inspection bookings can be made via our website. You must provide accurate details about the vehicle and its location.
- **Payment:** Payment is required at the time of booking. We accept various forms of electronic payment as indicated on our website.

4. Inspection Process

- **Scope:** The inspection includes a visual assessment of the vehicle's interior, exterior, engine bay, tyres, wheels, brakes, and a road test.
- **Limitations:** The inspection does not cover mechanical or technical systems not accessible without dismantling parts of the vehicle. Inspections are based on visible and accessible areas only; we do not remove parts or use invasive methods to inspect internal components.

5. CarFacts History Report

- **Inclusion:** Each inspection includes a CarFacts History Report providing data on (but not limited to) finance owing, PPSR, written-off status, registration status, stolen status, and odometer roll-back.
- **Accuracy:** The CarFacts History Report is compiled from third-party data, and Car Inspecta does not guarantee its accuracy.

6. What We Don't Inspect/Exclusions

- **Exclusions:** We do not inspect internal engine components, transmission, differentials, or any part requiring dismantling to access. Additionally, we do not cover electrical systems, air conditioning efficiency, or LPG systems. Our inspections are limited to what is visible and accessible during a Comprehensive inspection.

7. Customer Obligations

- **Accuracy:** Customers must provide accurate and complete information about the vehicle and its location.
- **Access:** Ensure the vehicle is accessible at the scheduled inspection time. Failure to provide access may result in additional fees or rescheduling.
- **Payment:** Ensure payment is completed at the time of booking to confirm the inspection appointment.

8. Road Test

- **Insurance Requirement:** A road test can only be conducted by the inspector if the seller's vehicle is insured.
- **Alternative Option:** Alternatively, the seller can drive the car while the inspector is in the passenger seat.

9. Car Inspecta Report

- **Report Contents:** The Car Inspecta Report includes findings from the visual inspection and the CarFacts History Report. It provides a detailed overview of the vehicle's condition based on the inspection scope.
- **Limitations:** The report is not a recommendation to buy or not buy a vehicle. It is a tool to help customers make informed decisions.

10. Definitions

- **Seller:** The person or entity offering the vehicle for sale.
- **Buyer:** The person or entity considering the purchase of the vehicle and who requests the inspection service.

11. Social Media Policy

- **Conduct:** Users must not post false, defamatory, abusive, or harassing comments about Car Inspecta on social media platforms.
- **Sharing:** Users may share their inspection experiences and Car Inspecta reports on social media, provided the content is accurate and not misleading.

12. Fees, Refunds, and Cancellations

- **Fees:** All fees for inspection services are clearly listed on our website. Additional charges may apply for services outside the standard inspection scope.
- **Refunds:** Refunds are processed for cancellations made more than 24 hours before the scheduled inspection. Refunds will be issued to the original payment method within 5-7 business days.
- **Cancellations:** Cancellations made within 24 hours of the scheduled inspection are not eligible for a refund. Rescheduling is possible but may incur additional fees if done within 24 hours of the inspection.
- **PPSR:** Car Inspecta will conduct a Personal Property Securities Register (PPSR) check on your prospective vehicle to ensure it is free from debt, has not been written off, and is not reported as stolen. Should any of these issues be identified, we will inform you prior to proceeding with the inspection. This process is designed to save you both time and money. If any issues are found, you will have the option to either inspect another vehicle or receive a refund. Please note, a fee of \$10 will be deducted from your refund to cover the cost of the PPSR check and associated administrative expenses.

13. Limitation of Liability

Car Inspecta is not liable for any indirect, incidental, or consequential damages arising from the inspection service. Our total liability is limited to the amount paid for the inspection service.

14. Complaints

- **Process:** Complaints must be submitted via a Complaints Form. Car Inspecta will review the inspection report and, if necessary, provide the mechanic's details for further resolution.
- **Refunds:** If the report does not comply with Australian Consumer Law, Car Inspecta will refund the cost of services, and the complaint will be considered resolved.

15. Intellectual Property

All content on the Car Inspecta website, including text, graphics, logos, and images, is the property of Car Inspecta or its content suppliers and is protected by copyright laws. You may not reproduce, distribute, or create derivative works from any content on this website without our prior written permission.

16. Privacy

Your use of our website and services is also governed by our Privacy Policy, which outlines how we collect, use, and protect your personal information.

17. Governing Law

These Terms are governed by the laws of the State of Victoria, Australia. Any disputes arising from these Terms will be subject to the exclusive jurisdiction of the courts in Victoria.

18. Changes to Terms

We may update these Terms from time to time. Any changes will be posted on this page with an updated effective date.

19. Contact Us

If you have any questions about these Terms, please contact us at:

- **Phone:** 1300 781 363
- **Email:** admin@carinspecta.com.au
- **Address:** 10 Belair Ave, Glenroy VIC 3046

By using our website and services, you agree to these Terms and Conditions.

Appendix



Photo 2



Photo 3



Photo 4



Photo 5



Photo 6



Photo 7



Photo 8

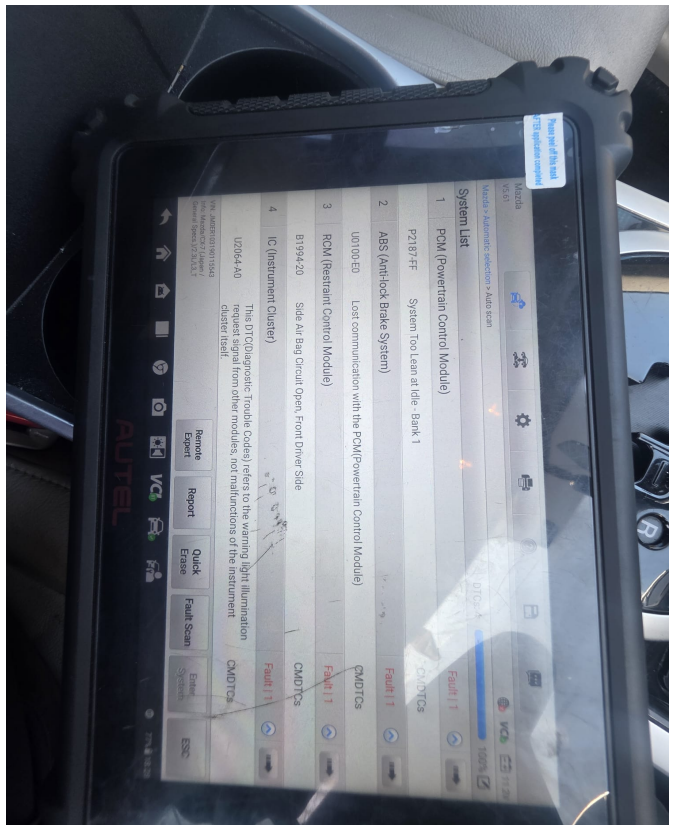


Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14

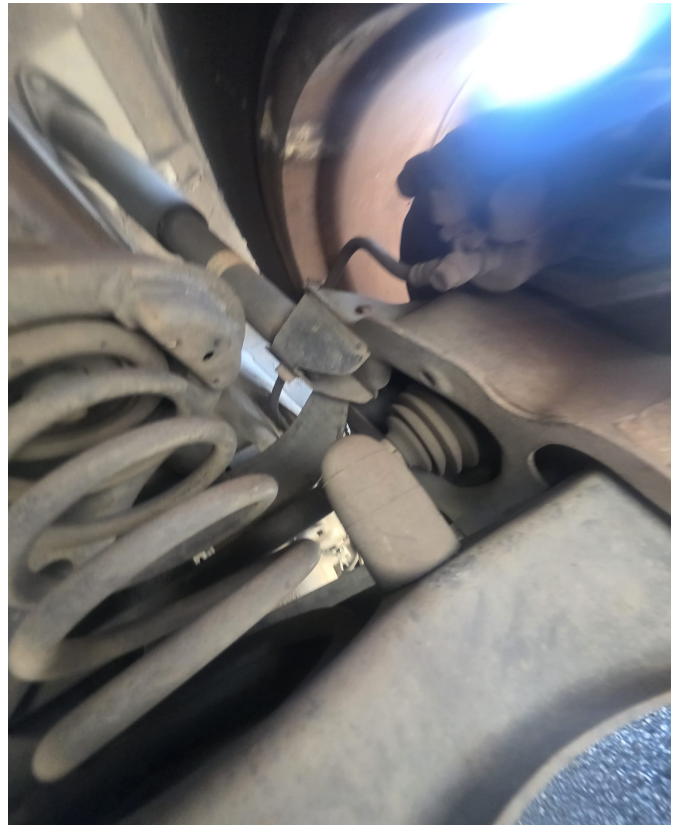


Photo 15



Photo 16

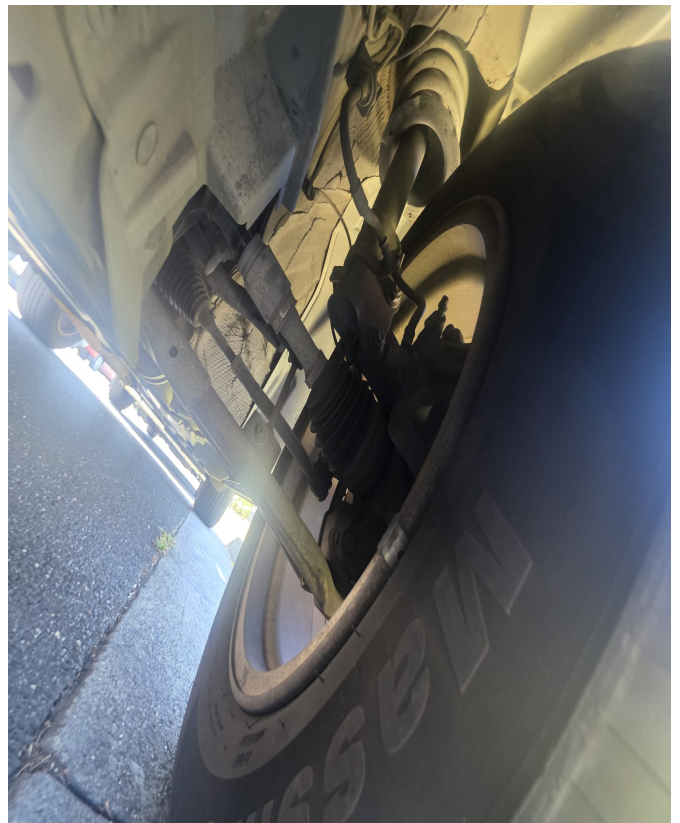


Photo 17



Photo 18

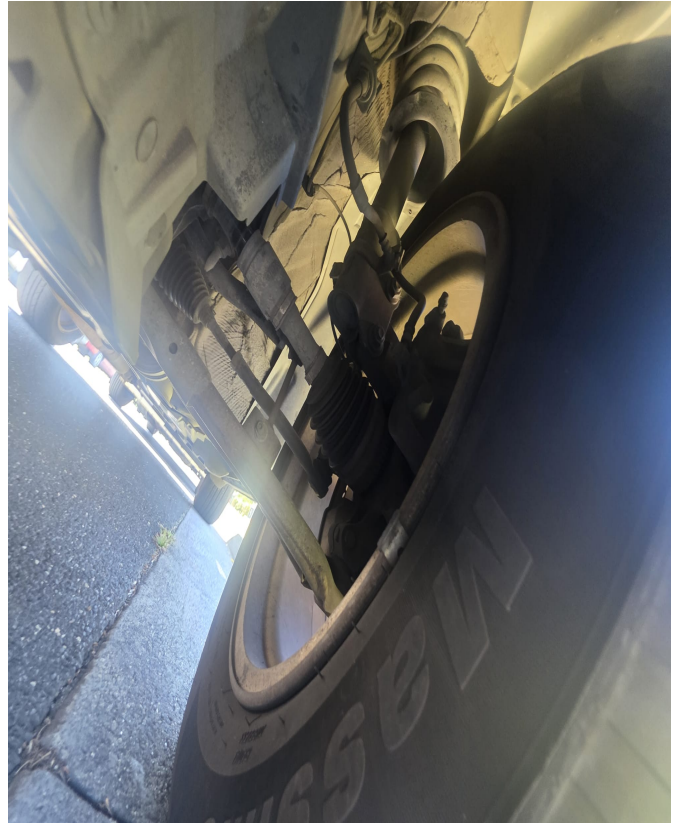


Photo 19



Photo 20

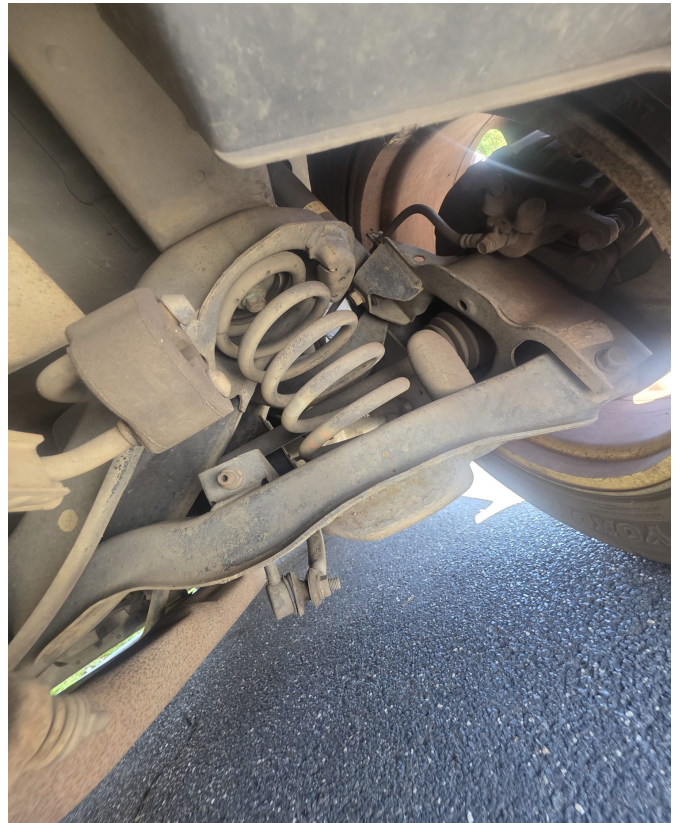


Photo 21



Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28



Photo 29



Photo 30



Photo 31



Photo 32



Photo 33